



IMPROPER SWITCH SCANNING IN THE TAPE MODES

In early JP-6 the program in either "SAVE" "VERIFY" or "LOAD" sequence sometimes cannot escape the mode even when TAPE is pressed for canceling TAPE mode. This is due to the fact that TAPE contact is not sensed by the switch scanning. To cure this problem the factory modifies the circuitry by adding TR3, R24-R26 on the Panel board R as shown in the diagram.

For the products SN prior to 311800, an alternative modification shown in CPU BOARD layout should be conducted for easier retrofit.

Remember that replacing CPU IC12 (CPU board) P8031 or P8051, with P8051-318 version does not cure the problem.

CPU BOARD



CPU BOARD

